

# Ceiling hoist

# Guldmann™

## Product-information/change GH2

Product-information No. 01-247  
Skejby, Date 29.08.2007

	Item No.:
GH2	120001-xxxx
GH2+2	120001-xxxx
GH2+R	120001-xxxx
GH2+2R	120001-xxxx
GH2 HD	120001-xxxx

Ready for delivery from stock




### GH2, GH2+2, GH2+R, GH2+2R & GH2 HD, GH2F Technical change, Fall Protection

To reach the updated Standard/Norm ISO/EN 10535:2006 (New Version) it has been necessary to implement a fall protection on the motor/gearbox on all hoists in the GH2 family.

The fall protection is placed in the gear box, and works as a wrap spring clutch. That means when the speed of rotation reaches a predefined speed, a special brake will be activated and will stop the hoist (lifting strap) immediately.

All hoists will continue with the same item number as today.

Motor for replacement on all GH2 hoists will get a new item number which is 12771-3. This number will replace item number 12771-2.

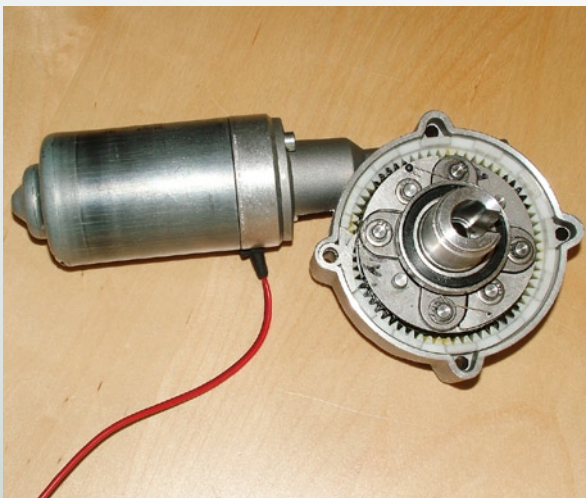

### This change is applicable from serial numbers

GH2	120001-3549-2007
GH2 HD	120001-2530-2007
GH2 F	120001-1149-2007

**NB:** No changes needed on existing hoists.